

Work Order ID 133277***133277***

Page 1

Item ID: D3391-025

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Tube Assembly

Start Date: 6/1/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 6/19/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals:

Process Plan: mfDate: 5-6-01

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

I

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.02

Mori Seiki CNC Lathe Large

Turn as per Folio FA599

Rev: AA & Dwg D3391 Rev: H

ensure steady rest is turning true

****REMOVE STEADY REST AND MACHINIG MARKS****

110

QC2- Inspect parts off machine FAI/FAIB

0.00

110

QC

Memo

0.00

Quality Control



mmL
15/06/22

mmL
15/06/23

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 133277

Monday, June 01, 2015 11:28:30 AM

133277

Page 2

Item ID: D3391-025 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Aft Tube Assembly
 Start Date: 6/1/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/19/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
112	QC5- Inspect part completeness to step on W/O	0.00							
112									
QC	Memo	0.00							
Quality Control									
120	HAAS CNC VERTICAL MACHINING #1	0.01							
120									
HAAS 1	Memo	0.03							
HAAS CNC vertical machine #1	1-Machine as per Folio FA 599 Rev: <u>AA</u> & Dwg D3391 Rev: <u>I</u> 2-Deburr								
130	QC2- Inspect parts off machine FAI/FAIB	0.00							
130									
QC	Memo	0.00							
Quality Control									

① 15-06-23 AD

1 0 DAS 20 9-89 15-06-27

1 0 DAS 20 9-89 15-06-27

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																		
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																
Description Work Order Deviation		Disposition		Completed By																																																																
				Lead hand / Supervisor Approval Verification																																																																
				QC / QA Coordinator Approval																																																																
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																			
Design ☐	Operator ☐																																																																			
Doc/Data ☐	Offset/Setup ☐																																																																			
Equip/Tooling ☐	Supplier ☐																																																																			
Handling/Pre ☐	Training ☐																																																																			
Material ☐	Use for Testing ☐																																																																			
Internal Transport ☐	Poor Information ☐																																																																			
Tribal Knowledge ☐	Rushing ☐																																																																			
LOA ☐	Product Improvement ☐																																																																			
Substation ☐	Process Improvement ☐																																																																			
Past Expiry Date ☐	Manufacturing Process ☐																																																																			
Misidentified ☐	Past Due ☐																																																																			
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																	
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																	
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																	
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																	
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																	
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																	
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																	
Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																	
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																	
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																	
OTHER :																																																																				

Work Order ID 133277

Monday, June 01, 2015 11:28:30 AM

133277

Page 3

Item ID: D3391-025 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Aft Tube Assembly
 Start Date: 6/1/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/19/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00							
140									
QC	Memo	0.00							
Quality Control	***INSPECT INSIDE BORE***								JPL 2015 06-29
150		0.00							
150	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803								15-6-30
160		0.00							
160	BENDING MACHINE - SKIDTUBES								
CNC Bend 1	Memo	0.00							
CNC Delta 100 Bender	Form as per Dwg D3391 Using Bend Prog 3391025								15-7-6

H-4.210"

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐				
Date :	Step #:	QTY Effective :			MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			Completed By	
					Lead hand / Supervisor Approval Verification	
					QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐				
OTHER : ☐						

Work Order ID 133277***133277***

Page 4

Item ID: D3391-025

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Tube Assembly

Stop ***NS2***

Start Date: 6/1/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/19/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp**DAS**
18
9-00

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Memo

0.00

Quality Control

1 0 BB-15-07-06

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 133277

Monday, June 01, 2015 11:28:30 AM

133277

Page 5

Item ID: D3391-025

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Tube Assembly

Start Date: 6/1/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/19/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

180

0.00

180

Skidtubes

Skidtubes

Memo

0.02

Skidtubes

1-Open Aft cap pilot hole to .208" as per Dwg D3391

2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only.

3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217
Wearplate Jig .

*****Do Not Open To Finished Size*****

4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2
previously drilled aft wearplate holes.

5-Open wearplate holes to 0.297" and c'bore as per dwg D3391

6-Open up all float bag holes to 0.328" and c'sink as per Dwg D3391.

7-Deburr

8- Scribe batch # on fwd end

15-7-8

15-7-8

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																																																																																																										
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																																																																																																								
Description Work Order Deviation			Disposition																																																																																																																																																									
			Completed By																																																																																																																																																									
			Lead hand / Supervisor Approval Verification																																																																																																																																																									
			QC / QA Coordinator Approval																																																																																																																																																									
<table border="1" style="width:100%; border-collapse: collapse;"> <thead> <tr> <th colspan="3" style="text-align: left;">Root Cause</th> <th colspan="4" style="text-align: left;">FAULT CATEGORY</th> </tr> </thead> <tbody> <tr> <td style="width:10%;">Environment</td><td>☐</td> <td style="width:10%;">No Re-verification</td><td>☐</td> <td style="width:10%;">Pressure/Forced</td><td>☐</td> <td style="width:10%;">Temperature/Cure</td><td>☐</td> <td style="width:10%;">Power Loss/Surge</td><td>☐</td> <td style="width:10%;">Positioned Wrong</td><td>☐</td> </tr> <tr> <td>Design</td><td>☐</td> <td>Operator</td><td>☐</td> <td>Bending</td><td>☐</td> <td>Set-up</td><td>☐</td> <td>Folio/Program</td><td>☐</td> <td>Outside Dimensions</td><td>☐</td> </tr> <tr> <td>Doc/Data</td><td>☐</td> <td>Offset/Setup</td><td>☐</td> <td>Centre Not Concentric</td><td>☐</td> <td>BOM/Route</td><td>☐</td> <td>Grain</td><td>☐</td> <td>Over/Under tolerance</td><td>☐</td> </tr> <tr> <td>Equip/Tooling</td><td>☐</td> <td>Supplier</td><td>☐</td> <td>Cracks</td><td>☐</td> <td>Broken/Damage/Defect</td><td>☐</td> <td>Weld</td><td>☐</td> <td>Part Incorrect</td><td>☐</td> </tr> <tr> <td>Handling/Pre</td><td>☐</td> <td>Training</td><td>☐</td> <td>Crimp/Kink/Ripple/Wave</td><td>☐</td> <td>Inspection Incomplete/Unqualified</td><td>☐</td> <td>Wrong Stock Pulled</td><td>☐</td> <td>Part Lost/Missing</td><td>☐</td> </tr> <tr> <td>Material</td><td>☐</td> <td>Use for Testing</td><td>☐</td> <td>Cuffs</td><td>☐</td> <td>Contamination</td><td>☐</td> <td>Out of Sequence</td><td>☐</td> <td>Part Moved</td><td>☐</td> </tr> <tr> <td>Internal Transport</td><td>☐</td> <td>Poor Information</td><td>☐</td> <td>Crushing</td><td>☐</td> <td>Countersink</td><td>☐</td> <td>Off-set</td><td>☐</td> <td>Drawing</td><td>☐</td> </tr> <tr> <td>Tribal Knowledge</td><td>☐</td> <td>Rushing</td><td>☐</td> <td>Heat Treat</td><td>☐</td> <td>Cut Too Short</td><td>☐</td> <td>Mislabeled</td><td>☐</td> <td>Finish</td><td>☐</td> </tr> <tr> <td>LOA</td><td>☐</td> <td>Product Improvement</td><td>☐</td> <td>Wave/Twist in Tube</td><td>☐</td> <td>Instructions Incomplete/Unclear</td><td>☐</td> <td>Fit/Function</td><td>☐</td> <td>Misread</td><td>☐</td> </tr> <tr> <td>Substation</td><td>☐</td> <td>Process Improvement</td><td>☐</td> <td>Marks/Chatter</td><td>☐</td> <td>Drill Holes</td><td>☐</td> <td>Misaligned/off center</td><td>☐</td> <td>Turning Sequence</td><td>☐</td> </tr> <tr> <td>Past Expiry Date</td><td>☐</td> <td>Manufacturing Process</td><td>☐</td> <td colspan="8"></td> </tr> <tr> <td>Misidentified</td><td>☐</td> <td>Past Due</td><td>☐</td> <td colspan="8">OTHER :</td> </tr> </tbody> </table>						Root Cause			FAULT CATEGORY				Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐	Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐	Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐	Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐	Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐	Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐	Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐	Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐	LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐	Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐	Past Expiry Date	☐	Manufacturing Process	☐									Misidentified	☐	Past Due	☐	OTHER :							
Root Cause			FAULT CATEGORY																																																																																																																																																									
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐																																																																																																																																																	
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐																																																																																																																																																	
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐																																																																																																																																																	
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐																																																																																																																																																	
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐																																																																																																																																																	
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐																																																																																																																																																	
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐																																																																																																																																																	
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐																																																																																																																																																	
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐																																																																																																																																																	
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐																																																																																																																																																	
Past Expiry Date	☐	Manufacturing Process	☐																																																																																																																																																									
Misidentified	☐	Past Due	☐	OTHER :																																																																																																																																																								

Work Order ID 133277

Monday, June 01, 2015 11:28:30 AM

133277

Page 6

Item ID: D3391-025

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Tube Assembly

Stop ***NS2***

Start Date: 6/1/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 6/19/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	QC5- Inspect part completeness to step on W/O	0.00							DAS 38 9-89
190						①			
QC	Memo	0.00							
Quality Control									
200	Chemical Conversion Coat per QSI005 4.1	0.00							
200									
HandFinish	Memo	0.01							
Hand Finishing									
210	QC7-Inspect Chemical Conversion Coat	0.00							
210									
QC	Memo	0.00							
Quality Control									

JUL 09 2015

15-7-9

1 8 BE150709

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 133277

Monday, June 01, 2015 11:28:30 AM

133277

Page 7

Item ID: D3391-025 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Aft Tube Assembly
Start Date: 6/1/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/19/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
220	Skidtubes	0.00							
220		0.01							
Skidtubes	Memo								
Skidtubes	1- Instal spacers as per dwg D3391 A/R Magnabond 6398 Batch: <u>M12/8/8</u> exp. date: <u>15-11-1</u> cure time 12hrs as per QSI0015								
	2- Grind crossbolts flush								
	3- Back drill using #9 drill								
	4- Touchup Magnabond								
	5- Deburr								
230	QC5- Inspect part completeness to step on W/O	0.00							
230									
QC	Memo	0.00							
Quality Control									

DAS
38
9-89

JUL 13 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Work Order ID 133277



133277

Page 8

Monday, June 01, 2015 11:28:30 AM

Item ID: D3391-025 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Aft Tube Assembly
 Start Date: 6/1/2015 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 6/19/2015 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

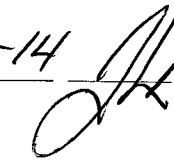Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
235	Pressure Wash per QSI005 4.3	0.00				1	15-7-14		
235									
HandFinish	Memo	0.01							
Hand Finishing	AND REALODINE AS PER PAR09-043								
240	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
240						1	15-7-15		
Powdercoat	Memo	0.00							
Powder Coating	START TIME: 2:30 OVEN TEMPERATURE: 300° FINISH TIME: 3:00								
250	QC3- Inspect Part Finish	0.00							
250						1	13/07/16		
QC	Memo	0.00							
Quality Control									

DAS
15
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

Work Order ID 133277***133277***

Page 10

Item ID: D3391-025 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Aft Tube Assembly
Start Date: 6/1/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 6/19/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
290	QC21- Final Inspection - Work Order Release	0.00							
290									
QC	Memo	0.00							
Quality Control									

ML5 *JUL 20 2015*
MF
15.7.20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Picklist Print

Monday, June 01, 2015 11:28:28 AM

Page 1

Work Order ID: 133277

133277

Parent Item: D3391-025

D3391-025

Parent Item Name: Aft Tube Assembly

Start Date: 6/1/2015

Required Date: 6/19/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev B 06-02-07 ECN773 dwg rev. D EC
 IPP Rev:C 06-03-28 Update Manuf. Instructions JLM
 IPP rev D 07.03.20 revF dwg EC
 IPP rev E 07.11.07 rev G dwg ecn 1053p EC verified by: DD
 IPP Rev:F 07-11-13 ECN 1056 DD verified by: EC
 IPP Rev:G 08-09-10 revH as per dwg DD verified by:EC IPP Rev:H
 11.11.14 AS PER REV.I DD verified by:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4095-047		Manufactured	No			260	Each	11.0000	1	1			
D4095-047													
Wearpad Aft													

**

15/07/16

Location	Loc Qty	Loc Code
FP001	11	
116100	11	

D4095-049		Manufactured	No			260	Each	37.0000	1	1			
D4095-049													
Wearpad Aft													

**

15/07/16

Location	Loc Qty	Loc Code
FP001	37	
116084	1	
126331	36	

D6014-090		Manufactured	No			100	Each	33.0000	1	1			
D6014-090													
ALUMINUM EXTRUSION													

**

Location	Loc Qty	Loc Code
LG003	33	
79742	1	
86063	32	

1 mm 15/06/12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Picklist Print

Monday, June 01, 2015 11:28:29 AM

Page 2

Work Order ID: 133277

133277

Parent Item: D3391-025

D3391-025

Parent Item Name: Aft Tube Assembly

Start Date: 6/1/2015

Required Date: 6/19/2015

Start Qty: 1.00

Required Qty: 1.00

D3670-4-200

Manufactured No

230

Each

36.0000

4

4

D3670-4-200

Bushing

**

15-7-9

Location

Loc Qty

Loc Code

FG

10

87709

10

LG002

134012

26

131146

26

4

D2646

Manufactured No

270

Each

34.0000

1

1

D2646

Aft Cap

**

15/07/16

Location

Loc Qty

Loc Code

FG

4

85848

2

90495

2

FP001

30

103306

1

114495

1

127924

7

128761

21

13132326

x1

D3672-1

Manufactured No

270

Each

558.0000

2

2

D3672-1

Washer, Phenolic

**

15/07/16

Location

Loc Qty

Loc Code

FG

10

85222

10

FP001

190

113581

190

ST055

358

120116

3

127322

355

x2

Monday, June 01, 2015 11:28:29 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER :					

Picklist Print

Monday, June 01, 2015 11:28:29 AM

Page 3

Work Order ID: 133277

133277

Parent Item: D3391-025

D3391-025

Parent Item Name: Aft Tube Assembly

Start Date: 6/1/2015

Required Date: 6/19/2015

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130 AELS4-1032-130 Purchased No

260 Each 2,955.000 14 14

AI S4-1032-130

Rivnut

all 15/07/16

Location

Loc Qty

Loc Code

CA

5

M128649

5

st549

2950

M132317

2950

X14

ALS4-1032-225 AELS8-1032-225 Purchased No

270 Each 1,193.000 8 8

AI S4-1032-225

Rivnut

all 15/07/16

Location

Loc Qty

Loc Code

FG

120

M127028

120

FP001

9

M131067

9

st549

1064

M131582

1064

X 0

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Picklist Print

Monday, June 01, 2015 11:28:29 AM

Page 4

Work Order ID: 133277

133277

Parent Item: D3391-025

D3391-025

Parent Item Name: Aft Tube Assembly

Start Date: 6/1/2015

Required Date: 6/19/2015

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

270

Each

1,146.000

6

6

AN3C4A

Bolt

ll 15/07/16

Location

Loc Qty

Loc Code

FG	20	M130551	<i>x6</i>
122814	20		
FP001	6		
M131803	6		
ST338a	1064		
M131320	4		
M132189	560		
M132317	500		
ST350	56		
125388	3		
M131420	53		

AN3C5A

Purchased

No

270

Each

372.0000

4

4

AN3C5A

Bolt

ll 15/07/16

Location

Loc Qty

Loc Code

FG	5		
122800	5		
FP001	6		
M131420	6		
ST	56		
<u>121708</u>	56		<i>x4</i>
ST338a	296		
M130851	16		
M131803	280		
ST350	9		
M131320	9		

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Monday, June 01, 2015 11:28:29 AM

Page 5

Work Order ID: 133277

133277

Parent Item: D3391-025

D3391-025

Parent Item Name: Aft Tube Assembly

Start Date: 6/1/2015

Required Date: 6/19/2015

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

270

Each

6,429.000

10

10

NAS1149C0332R

ll 15/07/16

WASHER

Location

Loc Qty

Loc Code

FP001

2140

m130325

2140

GA

346

m131618

346

ST260a

16

m131697

16

ST271

3927

m132262

3927

X10

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																								
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																									
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																									
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																									
Large Fab ☐	Composite ☐	Supplier ☐																																																																										
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																								
Description Work Order Deviation		Disposition		Completed By																																																																								
				Lead hand / Supervisor Approval Verification																																																																								
				QC / QA Coordinator Approval																																																																								
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> <td colspan="4"></td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> <td colspan="4"></td> </tr> </table>		Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐					Misidentified ☐	Past Due ☐					FAULT CATEGORY OTHER : _____		
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																							
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																							
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																							
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																							
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																							
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																							
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																							
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																							
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																							
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																							
Past Expiry Date ☐	Manufacturing Process ☐																																																																											
Misidentified ☐	Past Due ☐																																																																											

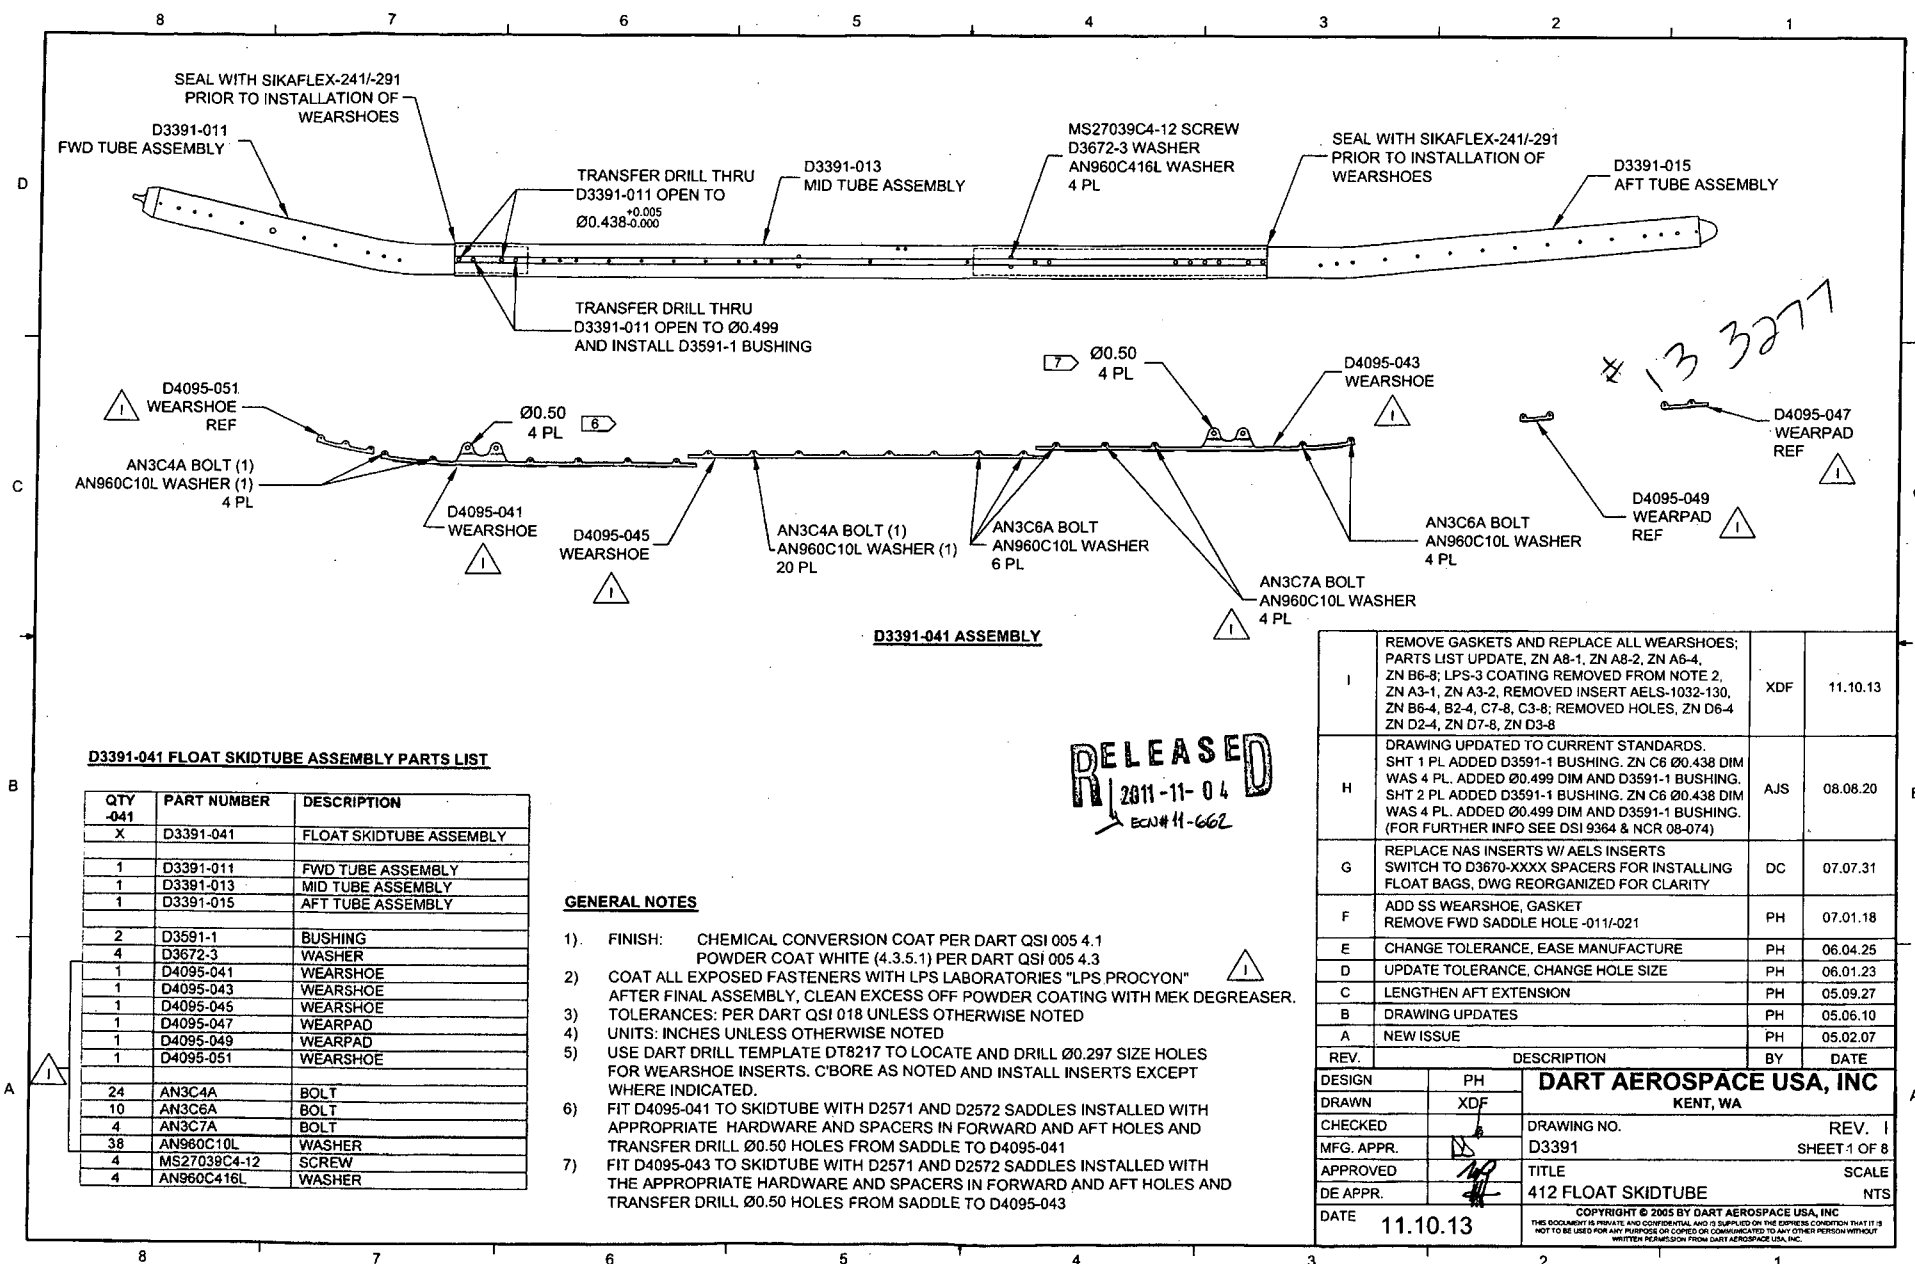

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARSHOE
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1). FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2). COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3). TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4). UNITS: INCHES UNLESS OTHERWISE NOTED
- 5). USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6). FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7). FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 1 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
							Lead hand / Supervisor Approval Verification																		
							QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																				
OTHER : ☐																									

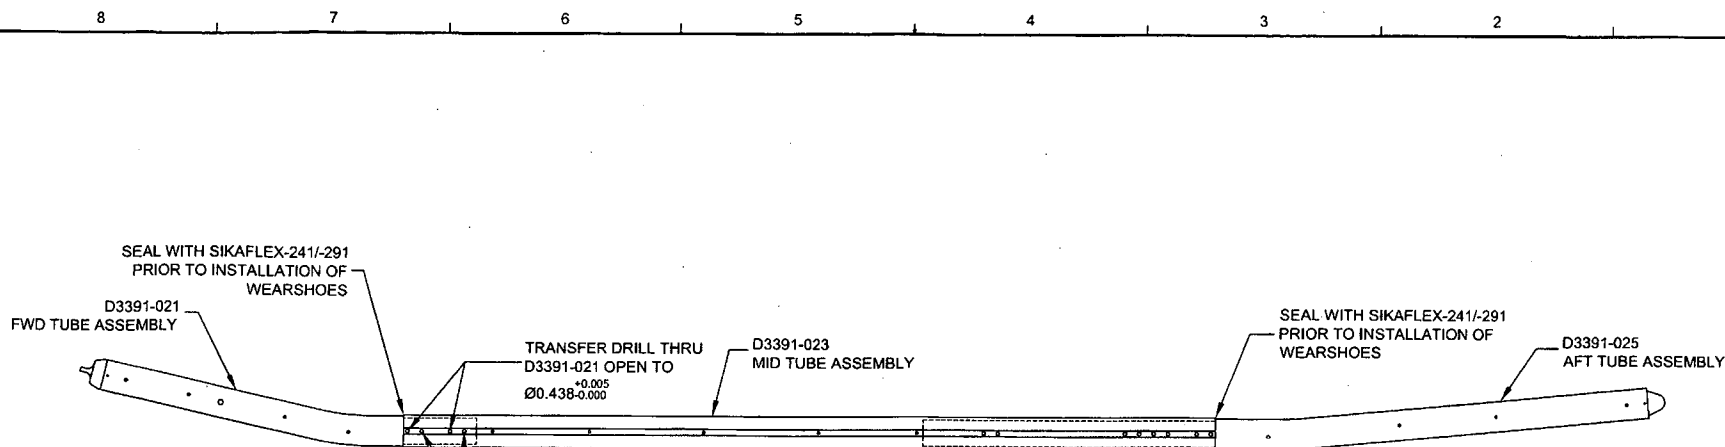

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -043	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
Root Cause		FAULT CATEGORY																							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____																							
Misidentified ☐	Past Due ☐																								

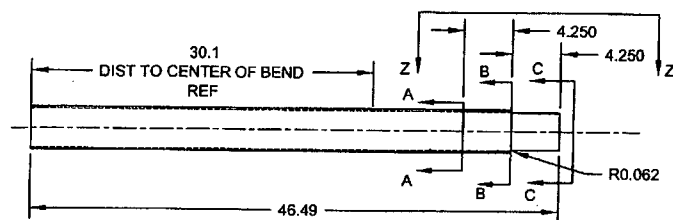


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

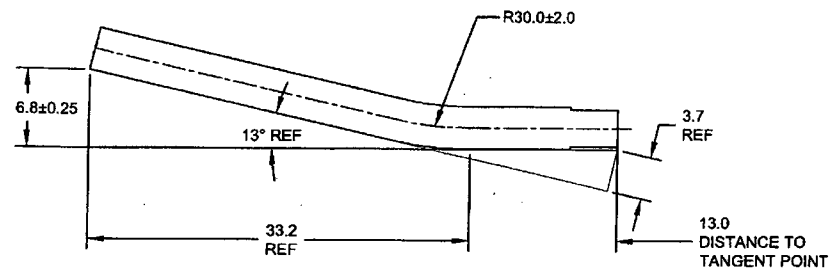


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

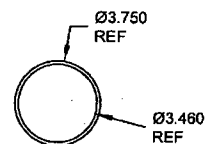


SECTION A-A
SCALE 2X

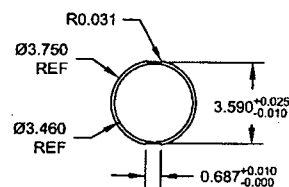

SECTION B-B
SCALE 2X

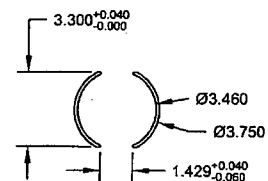

SECTION C-C
SCALE 2X

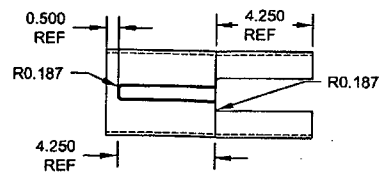

VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. I
MFG. APPR.			SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

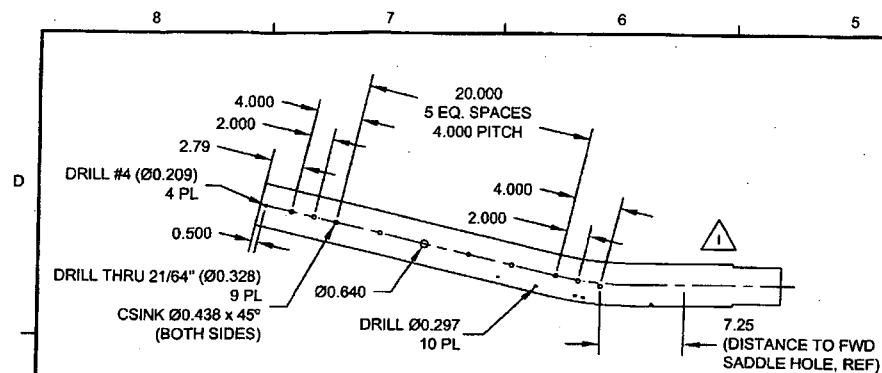


D3391-011 DRILLING DETAIL

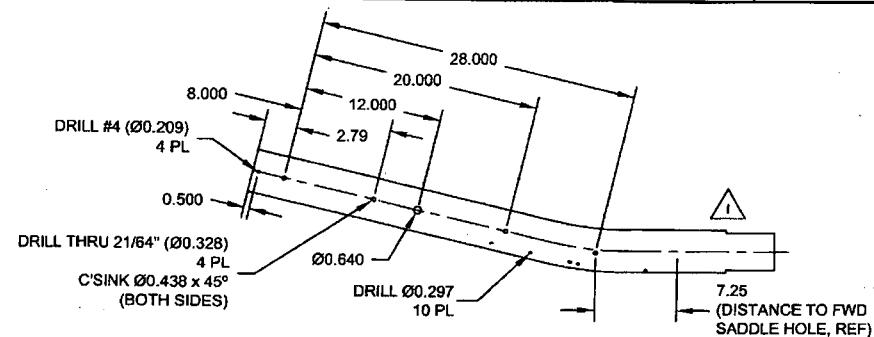

D3391-021 DRILLING DETAIL

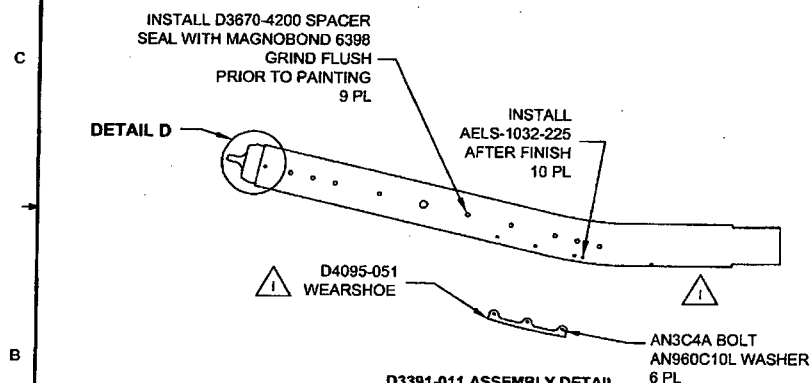

D3391-011 ASSEMBLY DETAIL

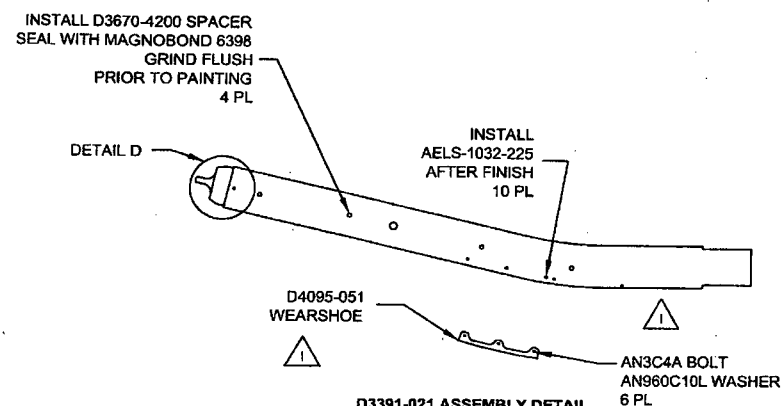

D3391-021 ASSEMBLY DETAIL

D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X	X	D3391-011	FWD TUBE ASSEMBLY
		D3391-021	FWD TUBE ASSEMBLY
1	1	D3401-041	TOW CAP
9	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	D4095-051	WEARSHOE
1	1	D6013-047	FWD TUBE
10	10	AN3C4A	BOLT
10	10	AN960C10L	WASHER
10	10	AELS-1032-225	INSERT

SEAL WITH
SIKAFLEX-241/-291



DETAIL D
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO. D3391	REV. I
MFG. APPR.			SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____










WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐





Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
									QC / QA Coordinator Approval																
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

8 7 6 5 4 3 2 1

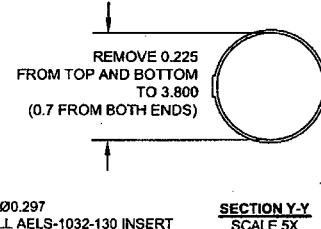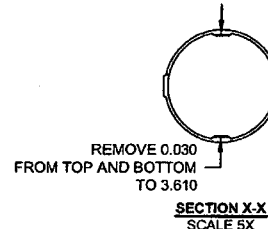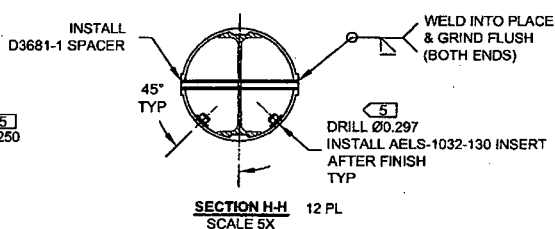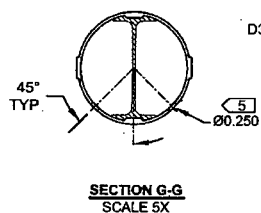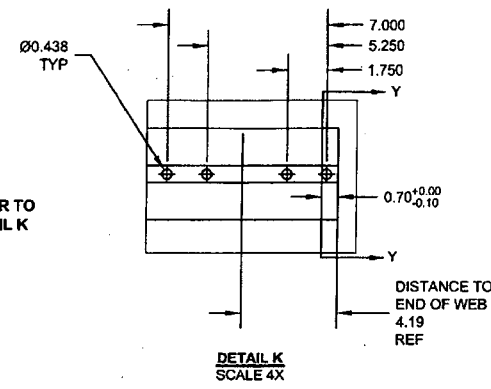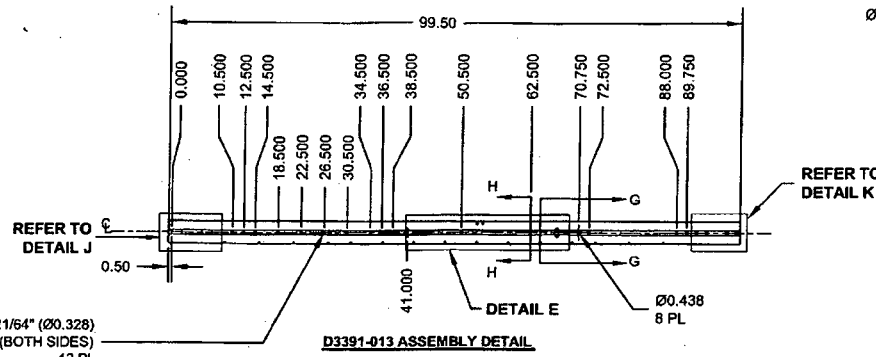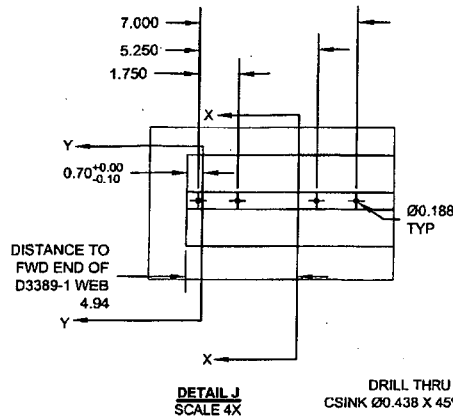

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-013		
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

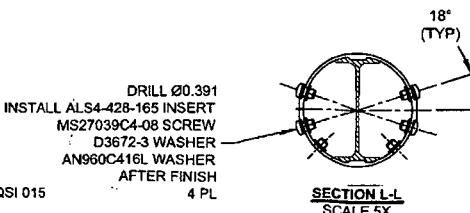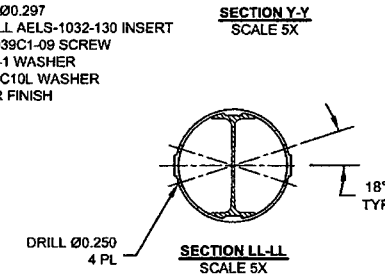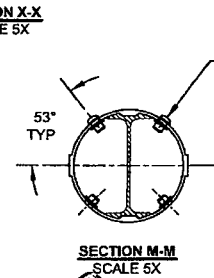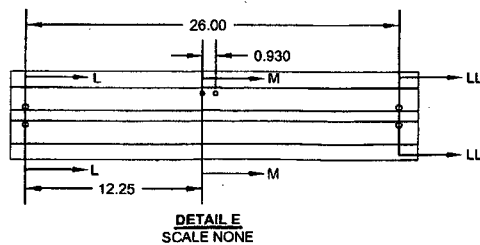

- D3391-013 MID TUBE ASSEMBLY
- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 - 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
 - 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="width: 15%;">Skid-tube ☐</td> <td style="width: 15%;">Cross tube ☐</td> <td style="width: 15%;">Water Jet ☐</td> <td style="width: 15%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
								Lead hand / Supervisor Approval Verification																	
								QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :																							
Misidentified ☐	Past Due ☐																								

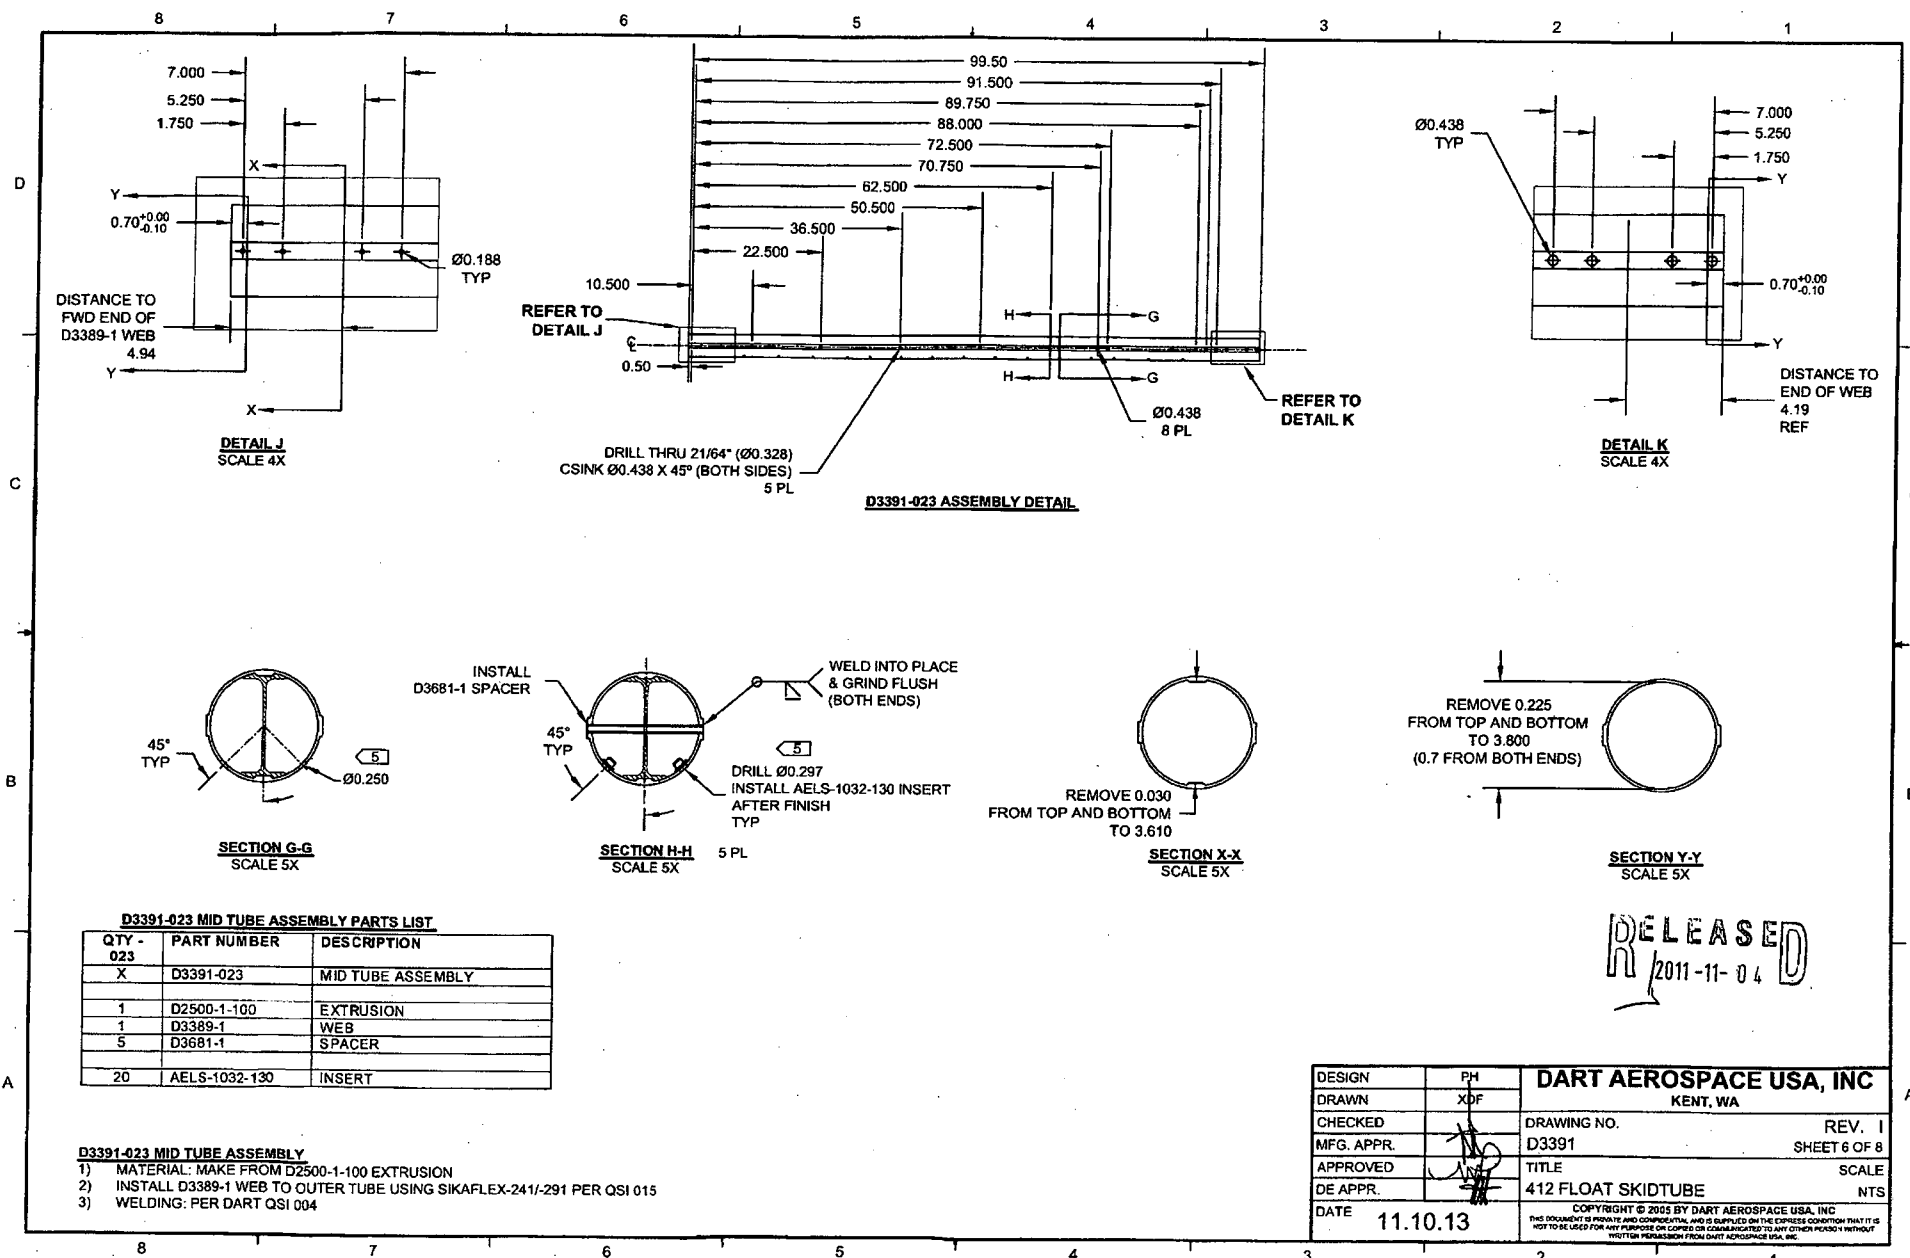

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
							Lead hand / Supervisor Approval Verification																		
							QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																	
OTHER : ☐																									

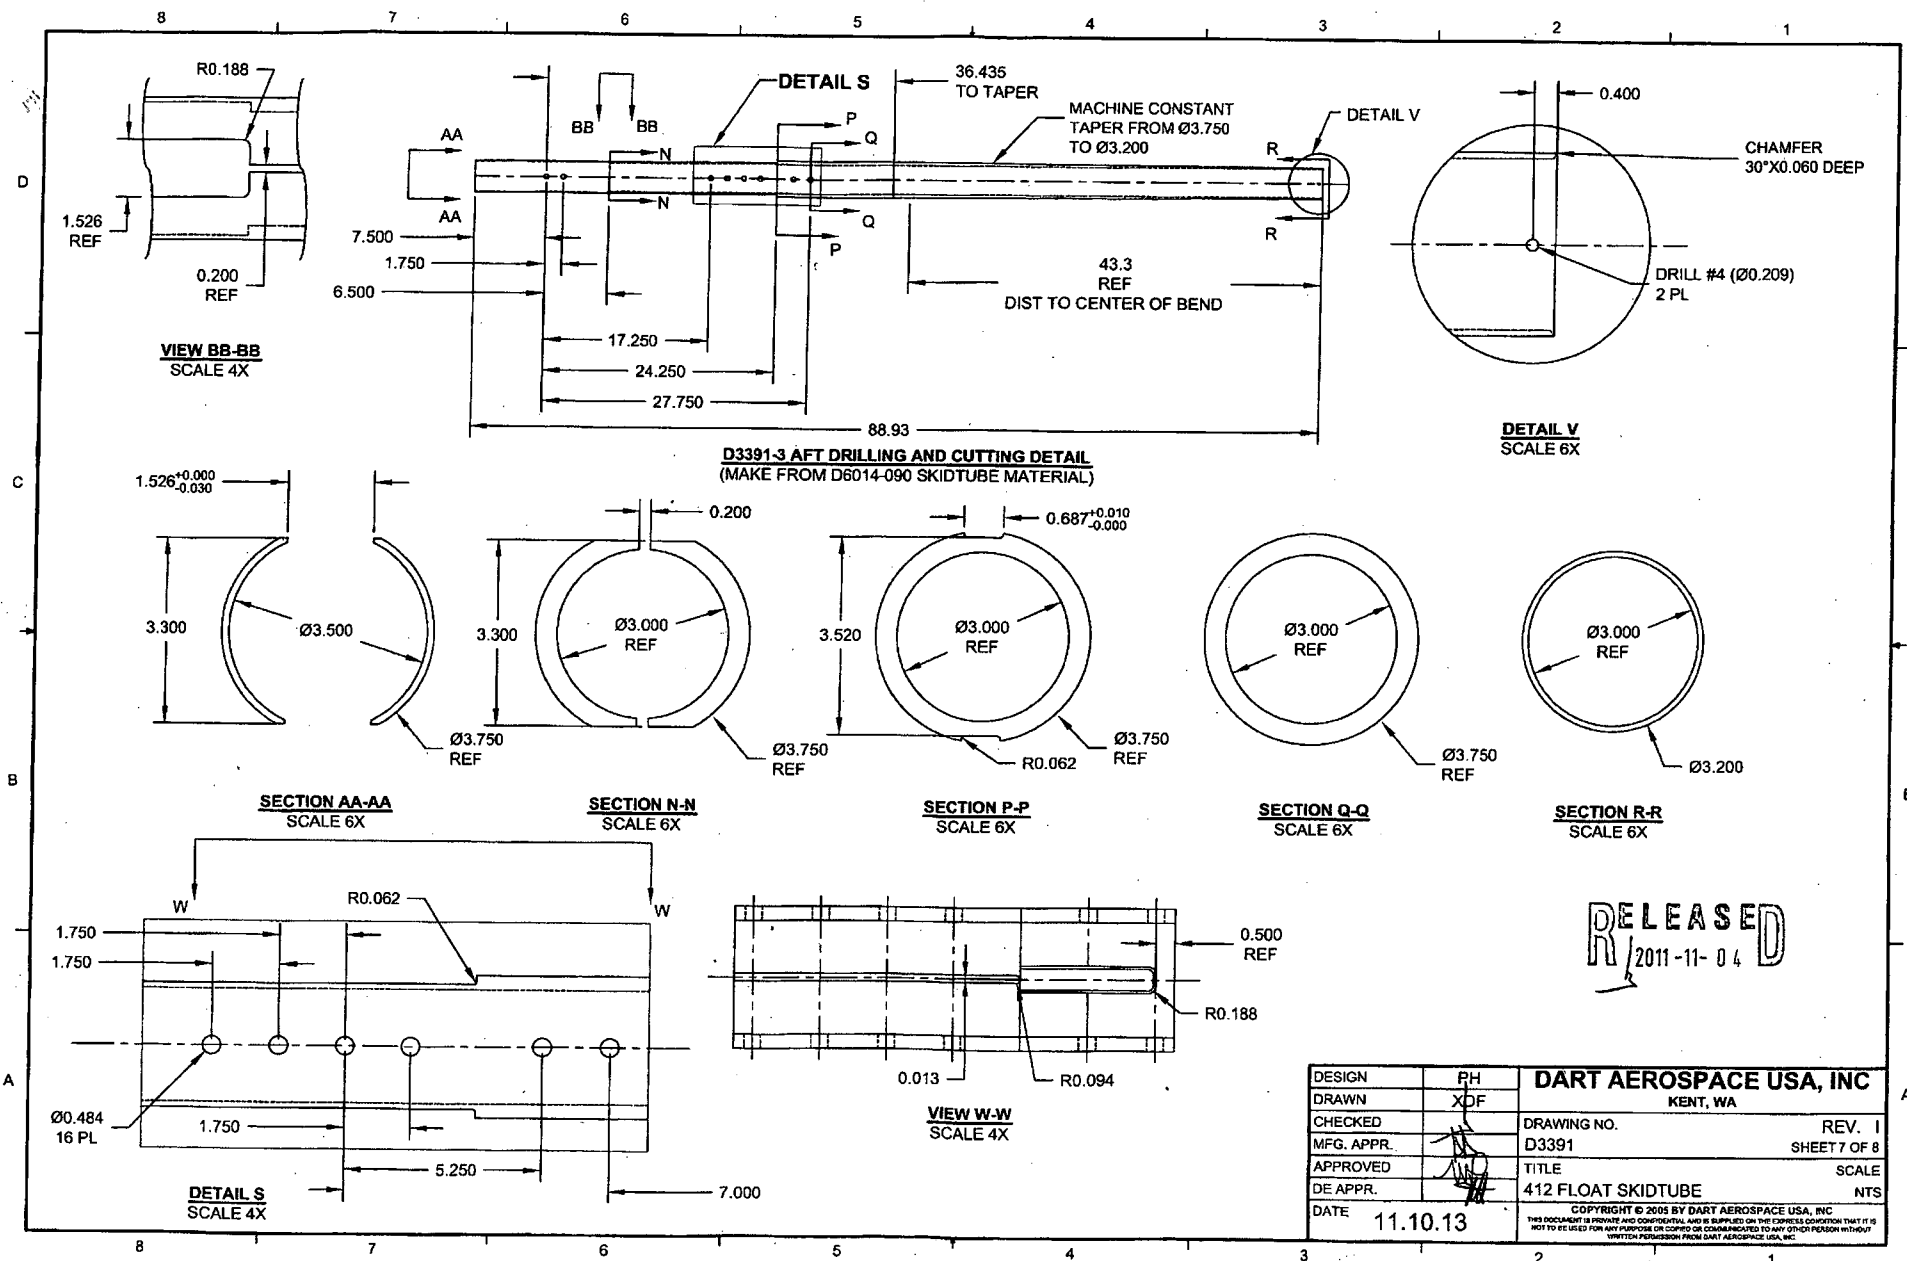

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐				
Misidentified ☐	Past Due ☐	OTHER : _____			

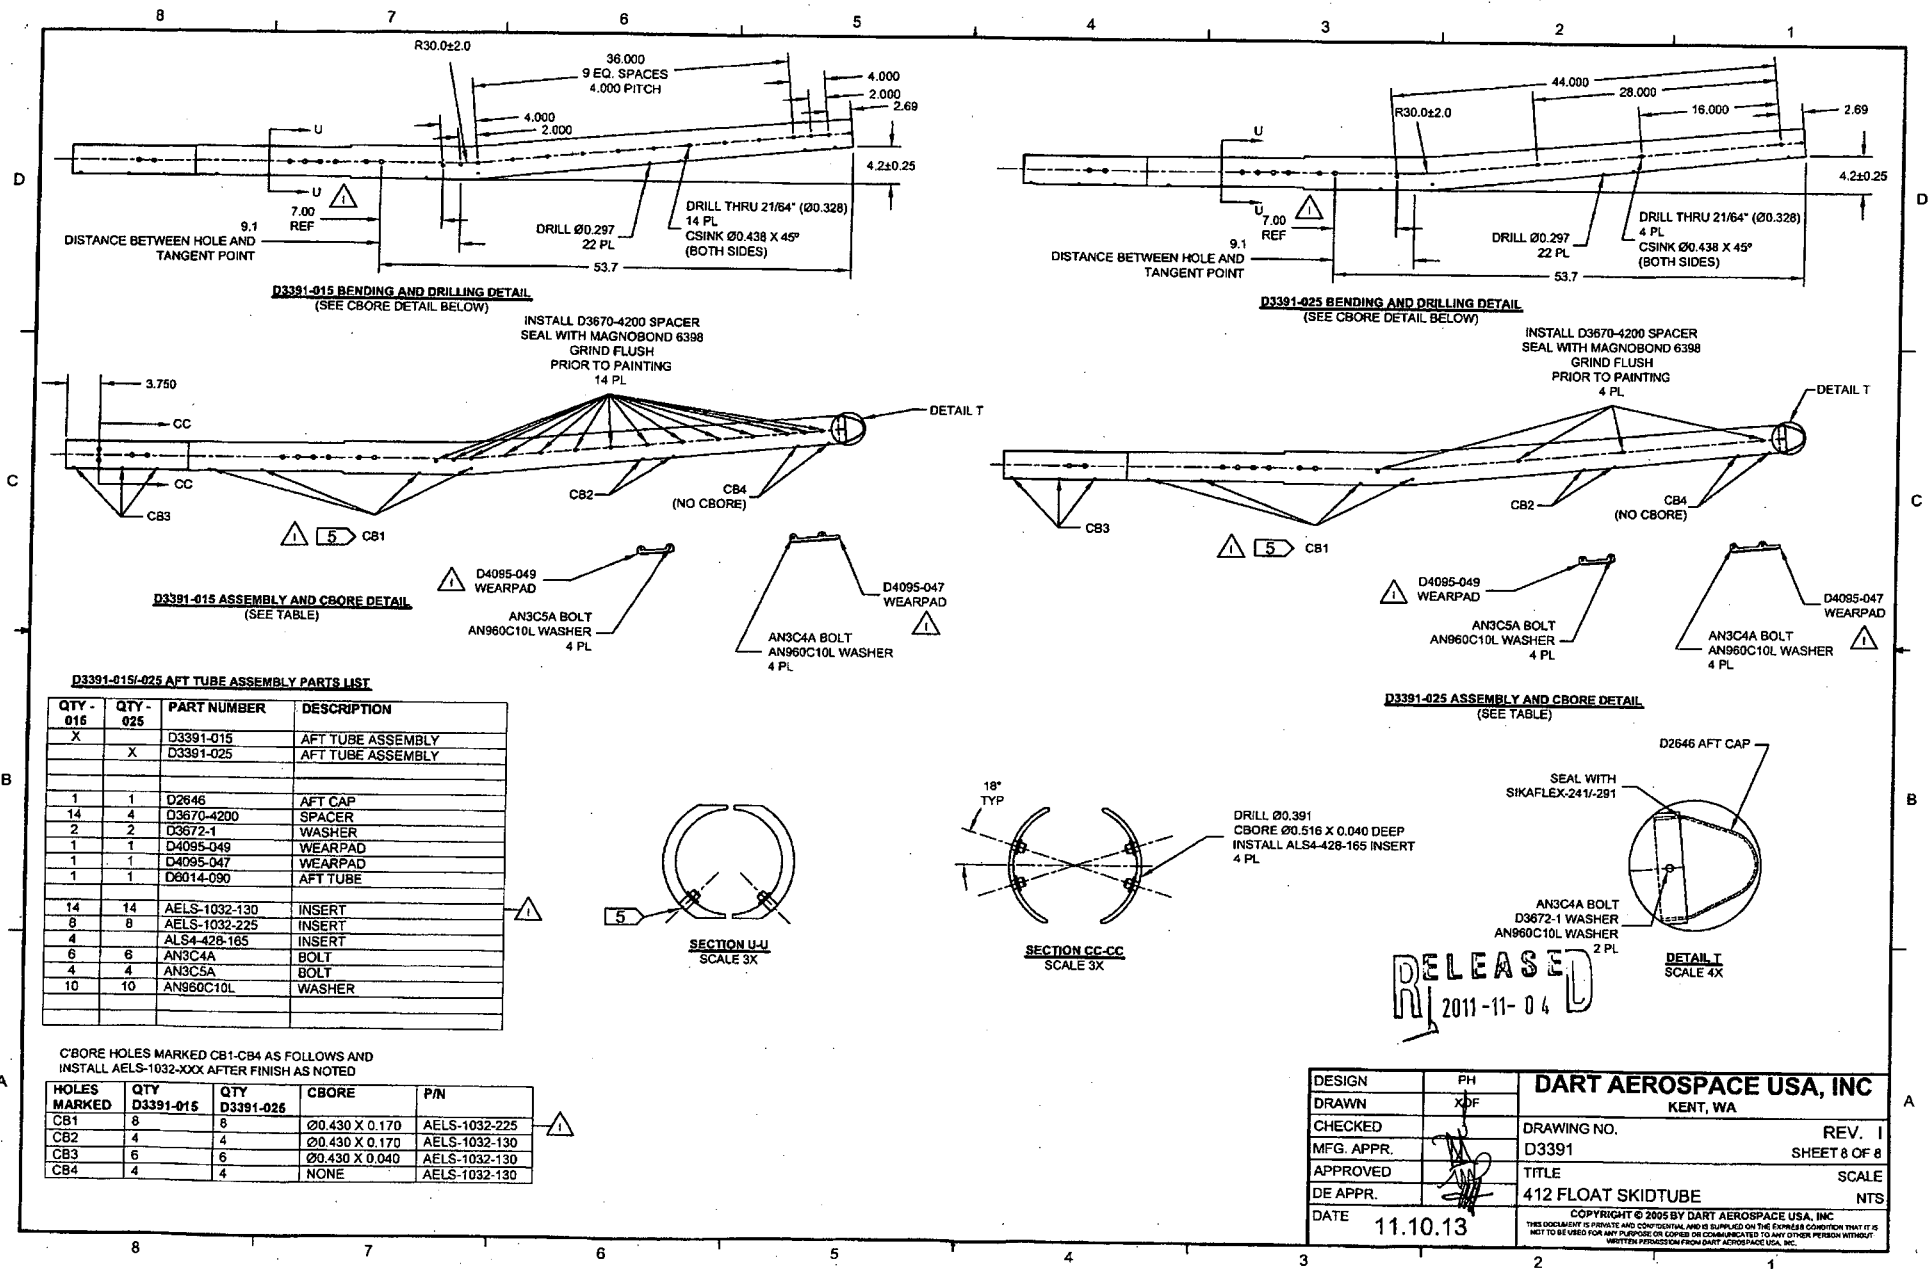

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
							Lead hand / Supervisor Approval Verification																		
							QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																				
OTHER : ☐																									

DART AEROSPACE LTD		Work Order: 133277
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: I	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
Lathe Section						
14.000	+/-0.010	14.00	✓			
3.500	+/-0.010	3.502	✓			
Ø3.200	+/-0.010	3.199	✓			
Ø3.750	+/-0.010	3.750	✓			
30° x 0.060 chamfer	+/-0.010	30° x .063	✓			
88.93	+/-0.030	88.93	✓			

Measured by: manil	Date: 15/06/22
Audited by: PD	Date: 15-06-23

HAAS Section						
1.526	+0.000/-0.030	1.520	✓		CNC 02	12" Vern
7.500	+/-0.010	7.499	✓		"	
27.750	+/-0.010	27.750	✓		SLOI	Tape
31.750	+/-0.010	31.750	✓		"	
35.250	+/-0.010	35.250	✓		"	
3.300	+/-0.010	3.299	✓		CNC-02	
0.200	+/-0.010	.200	✓		"	
3.520	+/-0.010	3.517	✓		"	
0.687	+0.010/-0.000	.689	✓		"	
R0.062	+/-0.010	.062	✓		"	
Ø0.484	+0.005/-0.001	.486	✓		"	

Measured by: 20 9-89	Date: 15-06-27
Audited by: JFL	Date: 2015-06-21

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	
F	09.04.27	Dimensions updated per Rev H and NCR09-028	KJ/JLM	
G	09.11.16	Dimension 0.200 removed	KJ	
H	11.06.21	Dimension 44.995 removed	KJ	
I	12.05.15	Dwg Rev updated	KJ	
J	12.05.23	Dimension updated	KJ	
K	12.10.15	88.93 dimension removed	KJ	
L	12.11.28	88.93 dimension added	KJ	

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																		
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																		
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																		
Large Fab ☐	Composite ☐	Supplier ☐																																																																			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval																																																																	
Description Work Order Deviation			Disposition		Completed By																																																																
					Lead hand / Supervisor Approval Verification																																																																
					QC / QA Coordinator Approval																																																																
Root Cause <table style="width:100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> </tr> </table>			Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%; border: none;"> <tr> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> </table>			Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Heat Treat ☐	Cut too Short ☐	Mislabeled ☐	Finish ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Environment ☐	No Re-verification ☐																																																																				
Design ☐	Operator ☐																																																																				
Doc/Data ☐	Offset/Setup ☐																																																																				
Equip/Tooling ☐	Supplier ☐																																																																				
Handling/Pre ☐	Training ☐																																																																				
Material ☐	Use for Testing ☐																																																																				
Internal Transport ☐	Poor Information ☐																																																																				
Tribal Knowledge ☐	Rushing ☐																																																																				
LOA ☐	Product Improvement ☐																																																																				
Substation ☐	Process Improvement ☐																																																																				
Past Expiry Date ☐	Manufacturing Process ☐																																																																				
Misidentified ☐	Past Due ☐																																																																				
Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																		
Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																		
Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																		
Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																		
Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																		
Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																		
Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																		
Heat Treat ☐	Cut too Short ☐	Mislabeled ☐	Finish ☐																																																																		
Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																		
Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																		
OTHER : _____																																																																					